

Product	<b>Contacts: 3, Female cable connector, 360° EMC safe, shieldable, iris type spring, cable outlet 4-5.5 mm</b>	Area	<b>M9 IP67 Series 712</b>
Pole	<b>3</b>	Article number	<b>99 0406 115 03</b>

Illustration	Scale drawing	Contact Arrangement												
		<table border="1" style="margin-left: auto; margin-right: auto;"> <thead> <tr> <th></th> <th>X</th> <th>Y</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>-1,55</td> <td>0,00</td> </tr> <tr> <td>2</td> <td>0,00</td> <td>1,55</td> </tr> <tr> <td>3</td> <td>1,55</td> <td>0,00</td> </tr> </tbody> </table>		X	Y	1	-1,55	0,00	2	0,00	1,55	3	1,55	0,00
	X	Y												
1	-1,55	0,00												
2	0,00	1,55												
3	1,55	0,00												

You can find the item description and assembly instruction on the next page.

## Technical data

### Common values

Connector Design	Female cable connector
Connector locking system	screw
Termination	Solder
Wire gauge (mm)	0.25 mm <sup>2</sup>
Wire gauge (AWG)	24
Cable outlet	3.5 - 5 mm
Upper temperature	85 °C
Lower temperature	-40 °C

### Cable data

material housing	-
Insulation single lead	-
Single lead structure	-
Conductor resistance	-

### Electrical values

Rated voltage	125 V
Rated impulse voltage	1500 V
Pollution degree	1
Overvoltage category	II
Material group	III
Rated current (40°C)	4 A
Volume resistivity	≤ 3 mΩ
EMV compliance	shieldable
Degree of protection	IP67
Mechanical operation	> 500 mating cycles


### Material

Material of contact	CuSn (Bronze)
Contact plating	Au (Gold)
Material of contact body	PA (UL 94 V-0)
Material of housing	CuZn (Brass nickel-plated)

Contacts: 3, Female cable connector, 360° EMC safe, shieldable, iris type spring, cable outlet 4-5.5 mm

Product	<b>Contacts: 3, Female cable connector, 360° EMC safe, shieldable, iris type spring, cable outlet 4-5.5 mm</b>	Area Article number	<b>M9 IP67 Series 712 99 0406 115 03</b>
Pole	<b>3</b>		

### Item description

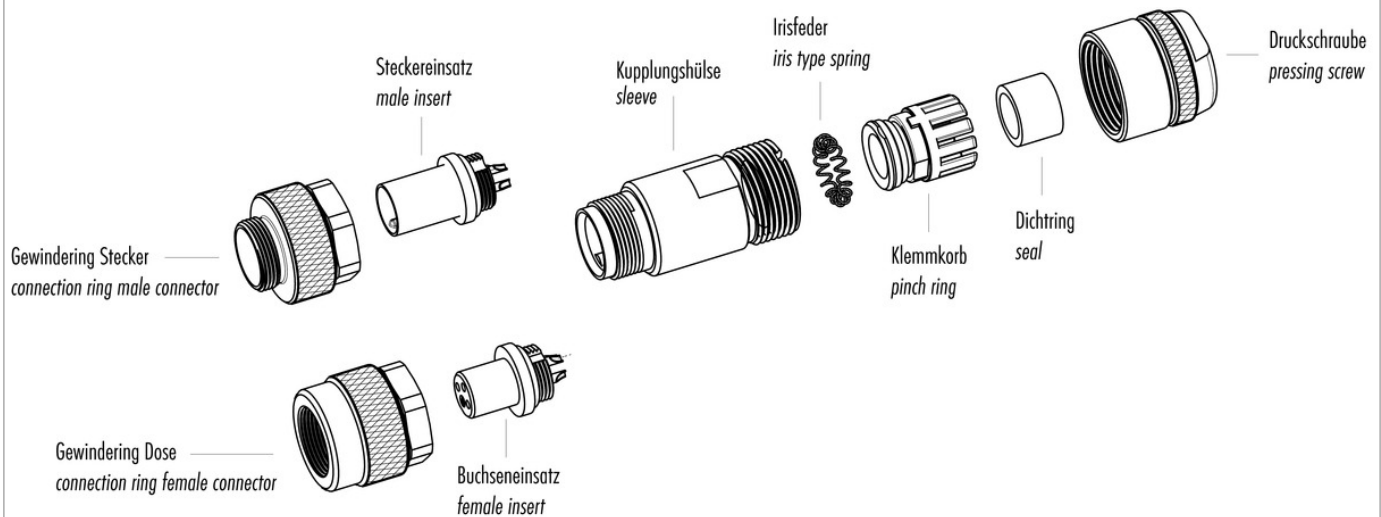

### Installation instructions / Mounting cutout

**Shielddurchmesser > 3,5 mm**

1. Gehäuse auf Kabel aufdübeln.
2. Abisolieren, Schirm kürzen.
3. Litzen anlöten.
4. Gehäuse mit Stecker- bzw. Buchseneinsatz verschrauben und Druckschraube festdrehen.

**Shield-diameter > 3,5 mm**

1. Bead housing to cable.
2. Strip single cores, shorten shielding braid.
3. Solder wires.
4. Screw housing to male or female contact carrier and fix pressing screw.

**Shielddurchmesser ≤ 3,5 mm**

1. Gehäuse auf Kabel aufdübeln.
2. Abisolieren, Schirm kürzen, Schirm über Kabelmantel legen, mit Kupfer-Schirmfolie ca. 1 1/2 mal umwickeln und die Folie kürzen.
3. Litzen anlöten.
4. Gehäuse mit Stecker- bzw. Buchseneinsatz verschrauben und Druckschraube festdrehen.

**Shield-diameter ≤ 3,5 mm**

1. Bead housing to cable.
2. Strip single cores, shorten shielding braid, put braid over cable coating, wrap it approx. 1 1/2 times with shielded copper tape and shorten tape.
3. Solder wires.
4. Screw housing to male or female contact carrier and fix pressing screw.

